



	Service Letter SL 17C	DO - No. EASA.21J.020
--	----------------------------------	----------------------------------

Important Information

Affected Parts:

In case a hub replacement of an MTV-9 / -12 / -14 / -15 is necessary, additional required material for serial numbers up to 97xxx is listed below.

Affected Propellers:

MTV-9 / -12 / -14 / -15

Reason:

Propellers on which the hub must be replaced during repair and overhaul.

Description:

Above mentioned propeller models must be assembled with new hub and additional parts as described below, according the Overhaul Manual E-220 (ATA 61-12-20).

Affected Publications:

Overhaul Manual E-220 (ATA 61-12-20)

Material Information

MTV-9- ():

2 Check nuts	A-893-A
1 Spring guide	A-1271-81
1 Front plate	A-1245
1 Piston guide rod	A-252-C x = 188 y = 146

MTV-12- ():

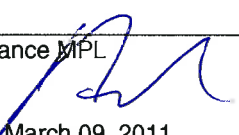
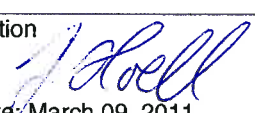
2 Check nuts	A-893-A
1 Spring guide	A-1271-72
1 Front plate	A-1245
1 Piston guide rod	A-252-C x = 174 y = 132

MTV-14- ():

2 Check nuts	A-893-A
1 Spring guide	A-1271-72
1 Front plate	A-1245
1 Piston guide rod	A-389-B x = 174 y = 132

MTV-15- ():

2 Check nuts	A-893-A
1 Spring guide	A-1271-81
1 Front plate	A-917-C
1 Piston guide rod	A-391-D x = 167 y = 145

Clearance MPL  Date: March 09, 2011	Edition  Date: March 09, 2011	Page 1 of 1
--	--	-------------