



Airport Straubing-Wallmühle
 94348 Atting / Germany
 Telefon 49-(0)9429-9409-0
 Telefax 49-(0)9429-8432
 E-mail: sales@mt-propeller.com

	Service Letter SL 24A	EB - Nr. JAA-LBA.NJA.009
--	--	-----------------------------

Important Information

Affected propeller:

All hydraulic MTV – Propellers.

Affected parts:

Propeller low / high – pitch stop

Check Nuts A-893-A M20 x 1,5

Slotted Nuts M20 x 1,5

Check Nuts A-817-A M30 x 1,5

Slotted Nuts M30 x 1,5

Reason:

Increase of mounting torque to avoid unintended movement of low / high pitch stop nuts.

Further Information:

Torque A-893-A M20 x 1,5 90 – 100 Nm (68 - 75 ftlbs)

Torque A-817-A M30 x 1,5 90 – 100 Nm (68 - 75 ftlbs)

Torque Slotted Nut M20 x 1,5 10 – 12 Nm (7,5 - 9 ftlbs)

Torque Slotted Nut M30 x 1,5 20 – 24 Nm (15 - 18 ftlbs)

Affected Publications:

All hydraulic Overhaul Manuals as well as Operation- and Installation Manuals

Clearence MPL  Date: March 07, 2003	Edition  Date: March 07, 2003		Page No.1 of 1
--	--	--	------------------------------