



	Service Letter SL 25	EB - No. JAA-LBA.NJA.009
--	---------------------------------	-----------------------------

Planning Information

Affected Parts:

Replacement of return spring, part no. A-085, by new return spring, part no. D - 389 - K.

Affected Propellers:

MTV-6- ()

Reason:

Under some circumstances the pitch change behavior is sluggish. Due to installation of a stiffer return spring the pitch change behavior is improved.

Description:

Due to the replacement of the return spring also other parts have to be exchanged in this connection as well according to the information as listed below.

Affected Publications:

Operation and Installation Manual List E-220, E-519,

Material Information:

MTV-6- ()	Pieces	Old	New
Return Spring	1	A-085	D - 389 - K
Front Plate	1	A - 086 - A	A - 923 - A
Guide Rod	1	A - 082 - A	A - 082 - C mod (length 140)
Spring Guide	1	A - 084 - X	A - 254 - B - 44
Nut	2	M20x1,5	A - 893 - B
Safety Plate	1	20DIN 462	not further required

Freigabe MPL Clearence MPL Datum: 28.01.2004 Date: January 28th, 2004	Ausgabe Edition vom: 28.01.2004 Date: January 28 th , 2004	Blatt Nr. 1 Page No. von 1 of
--	--	--