

	Service Letter SL 41 R1	DO - No. EASA.21J.020
--	------------------------------------	----------------------------------

Planning Information

Affected Parts:

Optional Replacement of Return Spring, part no. A-880, by new Return Spring, part no. A-1772 and A-1771-1.

Affected Propellers:

MTV-12- ()-C-F

NOTE: Not applicable with Piper PA 34-() Series with TCM TSIO-360 engines.

Reason:

Under some circumstances the pitch change behavior is sluggish.

Due to installation of stiffer return springs the pitch change behavior is improved.


Description:

Due to the replacement of the return spring also other parts have to be exchanged and/or modified in this connection as well as according to the information as listed below.

Affected Publications:

Overhaul Manual E-220

Material Information:

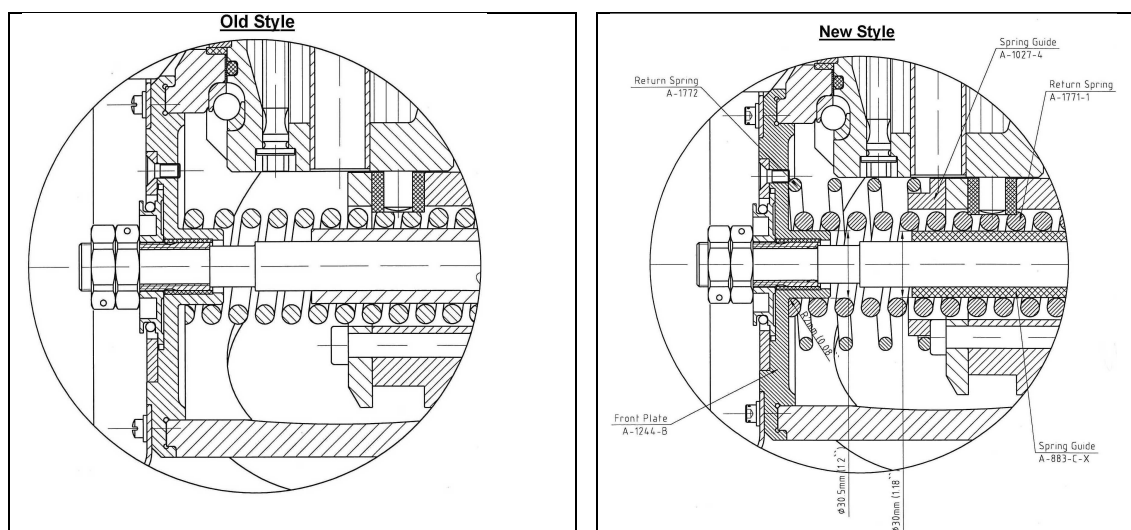

MTV-12-()-C-F	Pieces	Old Style	New Style
Return Spring	1	A-880	A-1771-1
Return Spring	1	---	A-1772
Front Plate	1	A-1244-A	A-1244-B or modification according to drawing "New Style"
Spring Guide	1	A-883-B-X	A-883-C-X or modification according to drawing "New Style"
Spring Guide	1	--	A-1027-4

Clearance MPL



Martin Albrecht
Date: June 23 ,2015

Edition



Andreas Seperant
Date: June 23 ,2015

Page 1 of 1