



	Service Letter SL 60	DO - No. EASA.21J.020
--	---------------------------------	----------------------------------

Modification of Counterweight Body A-1496-() Y()

Accomplishment:

During next modification / repair or overhaul of the propeller!

Affected Propeller:

MTV-16-1-N-C-F-R(P)/ CFRLD265-65

MTV-16-1-N-C-F-R(P)/ CFRLD280-65

Affected Parts:

Counterweight body A-1496-57 Y69.5 must be modified to Counterweight body A-1496-47 Y69.5 by reducing the total height by 10mm or a new counterweight body.

Reinstallation according to SL15.

Reason:


Reduction of loads on pitch change parts and therefore reducing the long time wear.

Description:

This modification reduces the wear due to reduced loads by 60% on the pitch change parts.

ATTENTION:

Individual replacement is not allowed, only a complete set of 4 counterweight bodies per propeller must be replaced.

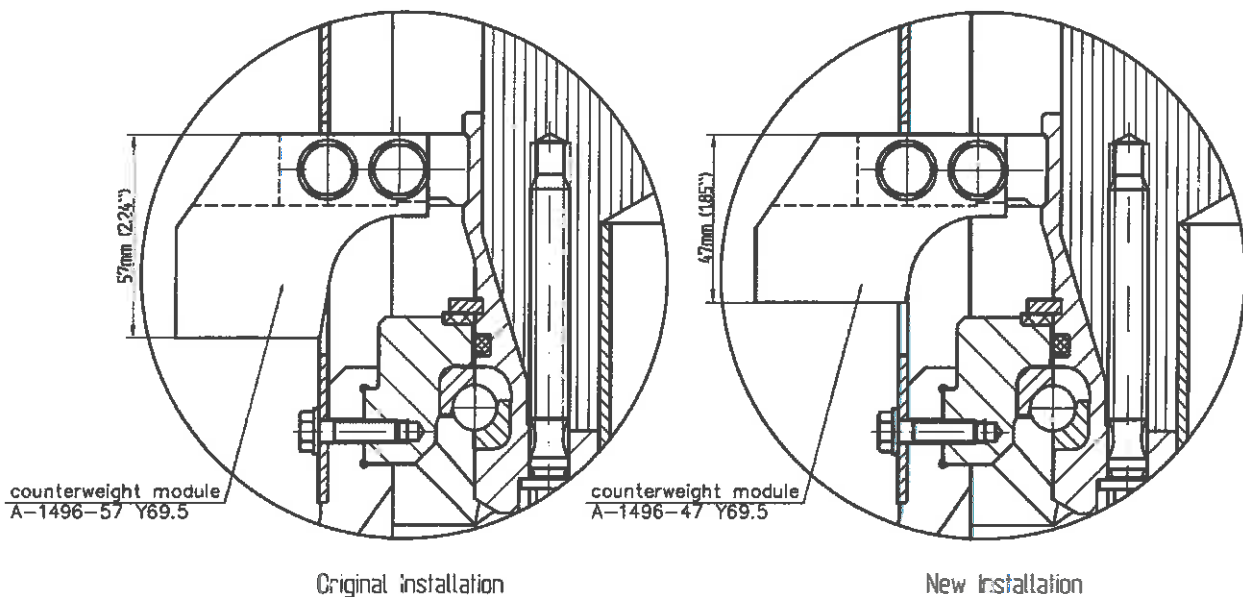

Clearance MPL Martin Albrecht Date: June 11, 2015	Edition Frank Grum Date: June 11, 2015		Page 1 of 1
--	---	--	--------------------