

	SERVICE LETTER SLE No. 77 - Original Issue	DOA No. EASA.21J.020
--	---	-------------------------

Subject: Length of the spinner fixture screws installed on spinner assembly part number P-1741-()

Affected Propeller: MTV-27-1-N-C-F-R(P)/CFR260-65b with spinner assembly part number P-1741-()

Reason: The length of the spinner screw C-306-9 could cause wear of the de-ice cables which are installed from the spinner bulk head to the connecting terminal on the blade counterweight clamp.

Action: The 10 red marked spinner screws C-306-9 (overall length 16,5 mm / 0,65 inch) should be replaced by the 10 shorter spinner screws C-306-8 (overall length 15 mm / 0,59 inch) which fixing the filler plate on spinner dome between front and rear spinner bulkhead.

 


Contact: MT-Propeller Entwicklung GmbH
Flugplatzstrasse 1
94348 Atting
Germany
e-mail: techsupport@mt-propeller.com

Checked/Approved by:
Head Office of Airworthiness

Martin Albrecht

Original Issue:
March 17, 2022

Issued by:

Andreas Seperant

The technical information contained in this document has been approved under the authority of EASA DOA N° EASA.21J.020.