

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

INSTRUCTIONS FOR CONTINUED AIRWORTHINESS

**E-3666 (EASA-STC)
E-3660 (FAA-STC)**

**MT-PROPELLER
MTV-47-1-N-C-F-R(P)-V/CFR260-361()**

ON

Pilatus PC-12/47E

with S/N 1720, 2001 and up with PT6E-67XP engine


AND

Pilatus PC-12/47G

with S/N 3001 and up with PT6E-67XP engine

The technical content of this document is approved under authority of the DOA No. EASA.21J.020

Published By:
MT-Propeller Entwicklung GmbH (DOA No. EASA.21J.020)
D-94348 Atting, Germany

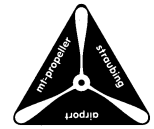


Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

Log of revisions

Rev. No.	Pages Revised	Description of Revision	Date
0	All	Initial Issue	June 10.2021
1	All	Editorial Change Second Document Number	Nov.03, 2022
2	1	PC-12/47G model added	December 15, 2025
3	2, 8	Information regarding later revisions added.	March 11, 2026
4	8	Chapter 13 revised	April 13, 2026


A black bar in the margin of a revised page shows the current change.

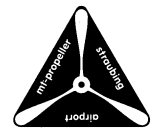

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

TABLE OF CONTENTS

TITLE	PAGE
1 INTRODUCTION	4
2 DESCRIPTION	6
3 CONTROL AND OPERATION INFORMATION	6
4 SERVICING INFORMATION	6
5 MAINTENANCE INSTRUCTIONS	7
6 REMOVAL AND REPLACEMENT INFORMATION	7
7 DIAGRAMS	7
8 TROUBLESHOOTING	7
9 LIST OF SPECIAL TOOLS	7
10 ADDITIONAL INFORMATION FOR COMMUTER CATEGORY AIRCRAFT	7
11 OVERHAUL PERIODS	7
12 AIRWORTHINESS LIMITATIONS	8
13 REVISIONS	8

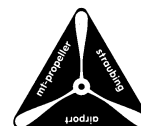

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

1 INTRODUCTION

This document outlines the compliance with CS and FAR 23.1529 “Instructions for Continued Airworthiness” MT-Propeller Entwicklung GmbH MT-Propeller model MTV-47-1-N-C-F-R(P)-V/CFR260-361() on Pilatus PC-12-Models.

Modification of Pilatus PC-12-Models with this STC obligates the airplane operator to include the maintenance information provided by this document in the Operator`s Aircraft Maintenance Manual and the Operator`s Aircraft Scheduled Maintenance Program.

APPLICABLE MANUALS

Approved Airplane Flight Manual Supplement Doc. No. E-3664, latest revision.

MT-Propeller Installation Instruction Doc. E-3665 latest revision.

MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083), latest revision.


APPLICABLE SERVICE BULLETINS / SERVICE LETTERS / SERVICE INSTRUCTIONS

MT-Propeller Service Bulletin No. 1 revision 1 or a later revision

MT-Propeller Service Letter No. 32 revision 2 or a later revision

MT-Propeller Service Instruction No. 4 revision 7 or a later revision

Additionally, see Note on next page.

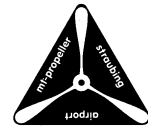

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

INTRODUCTION continued

Note:


Every owner should stay in close contact with his MT-Propeller Dealer or Distributor and Authorized MT-Propeller Service Shop to obtain the latest information pertaining to his propeller and its installation. MT-Propeller takes a continuing interest in having the owner get the most efficient use of his propeller and keeping it in the best mechanical condition. Consequently, MT-Propeller from time to time issues Service Bulletins, Service Letters and Manuals relating to the propeller and its installation. Service Bulletins are of special importance and should be complied with promptly. These are sent to dealers, distributors and latest registered owners. Service Letters deal with products improvements and service hints pertaining to the propeller and its installation. These are sent to dealers, distributors and occasionally (at the factory's discretion) to latest registered owners. If an owner is not having his propeller serviced by an Authorized MT-Propeller Service Shop, he should periodically check the MT-Propeller's homepage to find out the latest information to keep his propeller up to date.

The list of valid Manuals, Service Bulletins and their latest revisions can be downloaded from the homepage of MT-Propeller (www.mt-propeller.com) or be obtained from MT-Propellers Technical Support (techsupport@mt-propeller.com).

Hardcopies can also be obtained from MT-Propeller Germany and MT-Propeller USA.

MT-Propeller Entwicklung GmbH
Flugplatzstr.1
94348 Atting, Germany
Phone: +49-(0)-9429-9409-0
Fax: +49-(0)-9429-8432

MT-Propeller USA, Inc.
1180 Airport Terminal Drive
DeLand, FL 32724
Phone: 386-736-7762
Fax: 386-736-7696

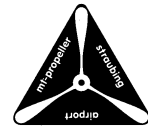

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

2 DESCRIPTION

This modification replaces the existing propeller with the MTV-47-1-N-C-F-R(P)-V/CFR260-361() constant speed propellers and MT-Propeller spinners. The existing propeller control system can be retained.

3 CONTROL AND OPERATION INFORMATION

Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083), latest revision.

Refer to MT-Propeller Installation Instruction Doc. E-3665, latest revision.

Refer to the Airplane Flight Manual Supplement, Doc. No. E-3664, latest revision.

4 SERVICING INFORMATION

MT-Propeller publications contain the information necessary to operate, maintain, and perform scheduled maintenance.

The list of valid MT-Propeller manuals, service bulletins and their latest revisions can be downloaded from the homepage of MT-Propeller (www.mt-propeller.com) or be obtained from MT-Propellers Technical Support (techsupport@mt-propeller.com).

Hardcopies can also be obtained from MT-Propeller Germany and MT-Propeller USA.


MT-Propeller Entwicklung GmbH
Flugplatzstr.1
94348 Atting, Germany
Phone: +49-(0)-9429-9409-0
Fax: +49-(0)-9429-8432

MT-Propeller USA, Inc.
1180 Airport Terminal Drive
DeLand, FL 32724
Phone: 386-736-7762
Fax: 386-736-7696

In case any propeller related technical problems are observed during operation please report to the technical support of MT-Propeller (techsupport@mt-propeller.com).

Since the MT-Propeller may also pick up loose pieces of rock and debris from the ramp and runway, the blades should be checked prior to each flight for damage. The daily preflight shall include examination of the propeller blades and spinners for visible damage, cracks, grease or oil leakage, blade shake and blade angle play. Blade shake up to 1/8 inches (3 mm) and a blade angle play of 2° is allowed. No attempt should be made to dress out nicks as would be done with metal propeller blades.

The propellers may be cleaned with a mild solution of soap and water. Do not use solvents.

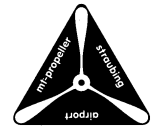

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

5 MAINTENANCE INSTRUCTIONS

Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083) and MT-Propeller Installation Instruction Doc. E-3665, latest revision.

6 REMOVAL AND REPLACEMENT INFORMATION

Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083) and MT-Propeller Installation Instruction Doc. E-3665, latest revision.

No mandatory replacement times for any MT propeller components.

7 DIAGRAMS

Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083).

8 TROUBLESHOOTING

Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083), Section 8.

9 LIST OF SPECIAL TOOLS


Refer to MT-Propeller Operation and Installation Manual Doc. No. ATA 61-00-83 (E-1083),

10 ADDITIONAL INFORMATION FOR COMMUTER CATEGORY AIRCRAFT

No additional information.

11 OVERHAUL PERIODS

Overhaul is the periodic disassembly, inspection, reconditioning and reassembly of the propeller. The recommended Time Between Overhauls (TBO) for this 7-blade MT propeller published in the MT-Propeller's SB No. 1, latest revision

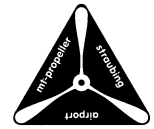

Doc. No. E-3666 E-3660	Instructions for Continued Airworthiness	DOA No. EASA.21J.020
---------------------------	---	-------------------------

12 AIRWORTHINESS LIMITATIONS

No additional Airworthiness Limitations.

No mandatory replacement times for any propeller components.

The Airworthiness Limitations Section is EASA approved in accordance with Part 21A.31(a)(3) and FAR/CS/JAR 23.1529. Variations must also be approved.

The Airworthiness Limitations Section is also FAA approved and specifies maintenance required under FAR 43.16 and 91.403 of the Federal Aviation Regulations unless an alternative program has been FAA approved.

13 REVISIONS

Any revisions to this document will be logged in the Log of Revisions sheet. A black bar at the margin of a revised page shows the current change.

The latest revision of this document can be downloaded from the homepage of MT-Propeller (www.mt-propeller.com) or be obtained from MT-Propellers Technical Support (techsupport@mt-propeller.com).

A hardcopy of this document can be obtained from MT-Propeller Germany and MT-Propeller USA.

MT-Propeller Entwicklung GmbH
Flugplatzstr.1
94348 Atting, Germany
Phone: +49-(0)-9429-9409-0
Fax: +49-(0)-9429-8432

MT-Propeller USA, Inc.
1180 Airport Terminal Drive
DeLand, FL 32724
Phone: 386-736-7762
Fax: 386-736-7696