



	Service Letter SL 36	DOA - No. EASA.21J.020
--	---------------------------------	---------------------------

Planning Information

Rework of Hub Inserts to Newest Technical Standard during next Overhaul and / or Repair

Affected Propeller:

➤ **MTV-16-1-N-C-F-R(P)** with following serial numbers:

s/n	s/n	s/n	s/n	s/n	s/n	s/n	s/n	s/n
05453	05061	06653	06654	06655	06683	06684	06685	06686
06687	06688	06689	06690	06691	06692	071157	071158	071159
071160	071161	071162	071163	071164	071165	071166	071167	071168
071454	071455	071456	080001	080002	080003	080004	080005	080006
080007								

➤ **MTV-27-1-N-C-F-R(P)** with following serial numbers:

s/n	s/n	s/n
071182	080947	080949

➤ **MTV-27-2-N-C-F-R(P)** with following serial numbers:

s/n	s/n	s/n	s/n	s/n	s/n	s/n
05448	05449	05450	05451	070703	070771	070772

Applicable Drawings:


	MTV-16-1-N-C-F-R(P)	MTV-27-1-N-C-F-R(P)	MTV-27-2-N-C-F-R(P)
Hub:	A-1490-1-C	A-1646-B	A-1533-C-R/L
Ring:	A-1491-A	A-1491-A	A-1491-A
New Hub Insert:	A-1488-C	A-1488-3-B	A-1488-1-A
Guide Ring:	C-276-435	C-276-445	C-276-445

Work Procedure:

- ✓ Rework Hub 1.0 according to applicable drawing
- ✓ Rework Ring 1.1 according to applicable drawing
- ✓ New Hub Insert + Guide Ring 1.2
- ✓ Tool required: T-715

Publications Affected:

Overhaul Manual E-680

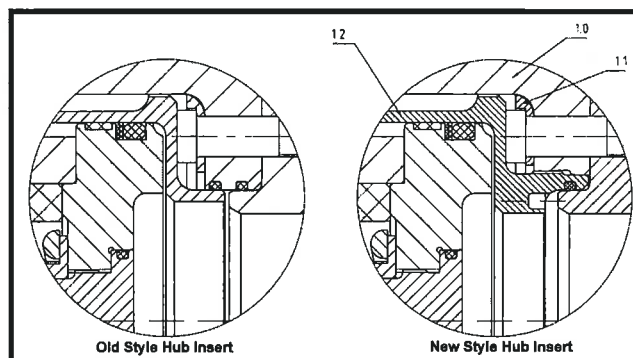

Above reworks are carried out only by Manufacturer, i.e. MT-Propeller Germany.

Clearance MPL Martin Albrecht Date: May 07, 2009	Edition Fini Hoell Date: May 07, 2009		
--	---	--	--