

	SERVICE BULLETIN No. 34 R1	DOA No. EASA.21J.020
--	---------------------------------------	---------------------------------

Subject: **Leading Edge Inspection**

Affected Propeller: MTV-33-1-A / ()-() - TCDS EASA-P.048
MTV-34-1-A / ()-() - TCDS EASA P.049 ,
**which are manufactured between 1.September 2017 until 1.June 2018
and listed per Serial Number on the next page.**

Reason: If the stainless steel leading edge shows signs of delamination along the
leading edge, it maybe result in a complete leading edge delamination.


Accomplishment: Before every flight during preflight inspection until the propeller
has been returned to MT for inspection.

Inspection Procedure: **1. Visual Inspection**

Inspect the leading edge visual for any impacts or delaminations.

2. Coin-Tap Test

Perform the coin-tap test to identify a delamination.

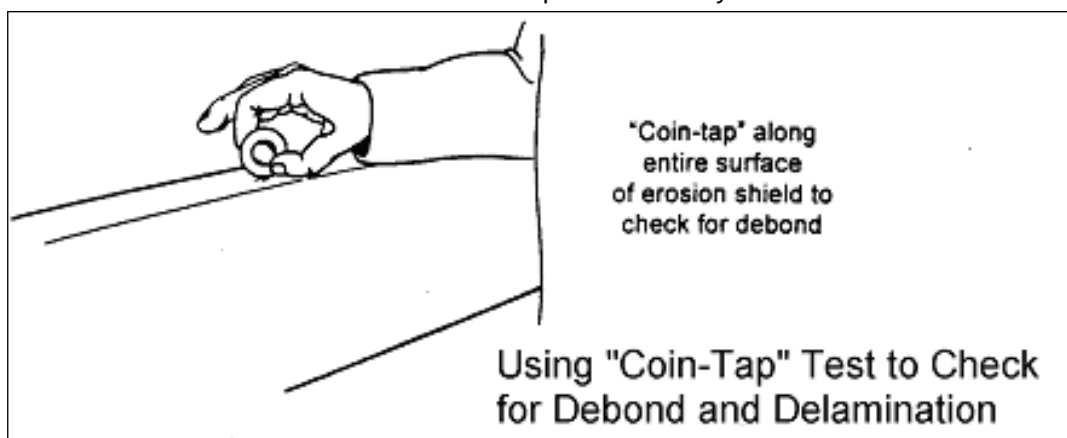

This Service Bulletin has been approved according the procedures established for the EASA-certified Design Organization No.: EASA.21J.020.

Checked / approved Head Office of Airworthiness  Martin Albrecht	July 15, 2020	Edition:  Andreas Seperant
---	----------------------	---



	SERVICE BULLETIN No. 34 R1	DOA No. EASA.21J.020
--	---------------------------------------	---------------------------------

Action:

If on one of the listed propellers below a delamination can be found, the stainless steel leading edge **MUST be replaced** by a new stainless steel leading edge.

For the replacement the propeller must be sent back to the MT Propeller factory or to one of the certified MT Propeller service center.

Affected Propeller Types and Serial Numbers :

MTV-33-1-A/175-200

141113
150157
180386
180387
180388
180389
180390
180391
180395
180434

MTV-34-1-A/175-200

130197
180439
180440



	SERVICE BULLETIN No. 34 R1	DOA No. EASA.21J.020
--	---	---------------------------------------

Service Bulletin 34

Compliance / Claim Form

Owner Information :

*Name:	
*Address:	
*Phone/Fax Number:	
*E-mail Address:	

Propeller Service Facility (Shipping Location):

*Name of Repair Facility :	
*Address :	
*Contact Person :	
*Phone/Fax Number:	

*Propeller Type:	
*Propeller Serial Number:	
*Blade Serial Number:	
*TSN / TSO	

Send this Order Form to: techsupport@mt-propeller.com

MT Propeller use only – do not write below this line

Warranty # :	Approved by:
--------------	--------------